# Pioneer

# System Firmware Update Instructions for Pioneer In-Dash AV Receivers

This firmware update applies only to the following models of Pioneer In-Dash AV Receivers sold in

Australia & New Zealand.

DMH-A5650BT	
SPH-DA77DAB	

### **IMPORTANT**

Please download and print these firmware update instructions before downloading and installing the firmware update. It is important that you complete all steps correctly and, in the order, described below.

Note: If you have any questions, please contact Pioneer Technical Support team at 1800 988 268, Monday through Friday, 9:00 AM - 4:30 PM (excluding holidays).

In order to perform this update, the following items are needed:

- Pioneer In-Dash AV receiver listed above.
- A USB storage device meeting the following requirements:
  - 2GB or larger in capacity, formatted to FAT32
  - Blank (should not contain any files)

### **CAUTION**

- DO NOT turn your unit off or eject the USB storage device while the firmware is being updated.
- You can only update the firmware when the vehicle is stopped, and the parking brake is engaged.

**WARNING:** Install this update only when the vehicle is **safely parked in an open, well-ventilated area**, **such as an outdoor parking lot**, where you can safely keep the engine running to maintain power to the battery. NEVER RUN YOUR VEHICLE'S ENGINE IN AN ENCLOSED SPACE, WHICH CAN QUICKLY FILL UP WITH TOXIC CARBON MONOXIDE GAS, LEADING TO SERIOUS INJURY OR DEATH.



# Checking the firmware version

Check whether the firmware of your unit needs to be updated by checking the version number of the firmware.

### Procedure:


1. Touch the following key.



2. Touch [System Settings].

Settings	×
System Settings	
Display Settings	
Audio & EQ Settings	
Wi-Fi Settings	
Bluetooth Settings	

3. Scroll down the list and touch [System Information].

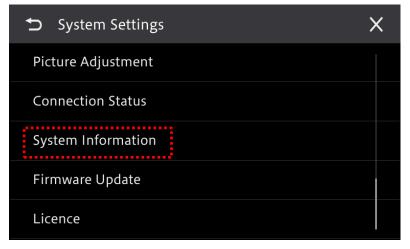



4. Check the current firmware version (SOC).

Note: the current SOC version on your unit will depend on when you purchased it. The image above merely shows where to find the SOC version.

System Information	×
Model Name: SPH-DA77DAB	
Serial Number: CATM123456EU	
MCU: PIO_WM02_1.0.01	
SOC: PIO_WS02_1.0.01	
Interface FW Version: 1.0.7	

## Checking the Model name

Perform the same procedure of "Checking the firmware version" to check the Model name of your product to determine which firmware update files you should download.

## Procedure:

1. Touch the following key.





2. Touch [System Settings].

Settings	×	< C
System Settings		
Display Settings		
Audio & EQ Settings		
Wi-Fi Settings		
Bluetooth Settings		

3. Scroll down the list and touch [System Information].

System Settings	×
Picture Adjustment	
Connection Status	
System Information	
Firmware Update	
Licence	

4. Check the Model Name.

PS: Model Name depends on the Head unit you purchased; the image below is for reference purposes.

System Information	X
Model Name: SPH-DA77DAB	
Serial Number: CATM123456EU	
MCU: PIO_WM02_1.0.01	
SOC: PIO_WS02_1.0.01	
Interface FW Version: 1.0.7	

# Pioneer

## Downloading the firmware update files from Pioneer's website

- 1. Download the firmware update files by clicking on the following link and finding your product: <u>https://www.pioneer.com.au/firmwaresoftware/</u>
- 2. Extract the download file.

The downloaded zip file will produce the following file when decompressed: (See the table below)

Model Name	Update is necessary when	Extracted file Name	Version
	The last 4 digits of the current SOC	update (folder)	SOC:PIO_WS0
DMH-A5650BT	version are lower than "1.0.07"	- CUST_PIO.BIN	3_1.0.07
		- CUST_PIO.md5	
	The last 4 digits of the current SOC	update (folder)	SOC:PIO_WS0
SPH-DA77DAB	version are lower than "1.0.07"	- CUST_PIO.BIN	2_1.0.07
		- CUST_PIO.md5	

\*1 You can check the last 4 digits of the current SOC version as below:

System Information	×
Model Name: SPH-DA77DAB	
Serial Number: CATM123456EU	
MCU: PIO_WM02_1.0.01	
SOC: PIO_WS02_1.0.01	
Interface FW Version: 1.0.7	

Note: the current SOC version on your unit will depend on the model and when you purchased it; the image above is for reference purposes.



### **IMPORTANT**


## DMH-A5650BT SPH-DA77DAB

- DO NOT perform this firmware update if the model number of your Pioneer product is anything other than one of the above models.
- Ensure that the update folder is located within the root (top) folder of your USB storage device. There should be no other files within the USB storage device.
- While your unit is being updated, DO NOT turn off the system's power and DO NOT touch the unit's touchscreen as this may result in severe damage to your unit.
- DO NOT remove the USB storage device during the firmware update process.
- Disconnect any external mobile devices that are currently connected to your unit.
- A loud "pop" sound will occur when connecting to an external amplifier after the "Update succeeded" screen is displayed\_(see step 11 below); this is not a malfunction.

### Procedure:

 Connect a blank (formatted with FAT32) USB storage device to your computer, and then locate the correct update folder (include file CUST\_PIO.BIN&CUST\_PIO.md5) and copy it onto the root (top) folder of USB storage device.

## Root:\

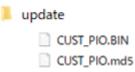

2. Connect the USB storage device to the USB port.

3. Touch the following key.




		1/1 Mor	12:00	Source OFF
		dab+	*	
		DAB	Bluetooth Audio	
C		Ð	\$	- +
Apple CarPlay	Android Auto		Settings	
Sources			🖊 Edit	« 1/3 »

4. Touch [System Settings].

Settings	×	
System Settings		
Display Settings		
Audio & EQ Settings		
Wi-Fi Settings		
Bluetooth Settings		

5. Scroll down the list and touch [Firmware Update].

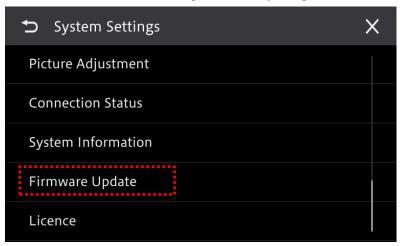

Tip: If [Firmware Update] key is invalid, perform step 1, confirm the update file located correctly and confirm the update file is downloaded correctly.

6. Update file reading.



Firmware Update	
Reading	

7. New Firmware Version is displayed.



8. Touch [Update].



9. The progress is displayed during the updating.





**DO NOT** turn your unit off or eject the USB storage device while the firmware is being updated.

10. Display will show "It succeeded..." when the update is complete.

Please disconnect the USB storage device.

It succeeded.
OK to disconnect USB memory.
DO NOT DRIVE CAR WHILE THIS MESSAGE IS DISPLAYED
100%

A pop sound will occur when connecting to an external amplifier after the "Update succeeded" screen is displayed; this is not a malfunction.



blacked out. After it has finished rebooting, the screen will return to the home menu screen.



12. The firmware update is now completed. Your Pioneer AV Receiver is now ready for use.

## Confirm that the firmware has been updated

Perform the same procedure for "Checking the firmware version" to confirm that the firmware has been updated.

### Procedure:

1. Touch the following key.



2. Touch [System Settings].



Settings	×
System Settings	
Display Settings	
Audio & EQ Settings	
Wi-Fi Settings	
Bluetooth Settings	

3. Scroll down the list and touch [System Information].

System Settings	×
Picture Adjustment	
Connection Status	
System Information	
Firmware Update	
Licence	

4. Check the firmware updated to new version.

System Information	×
Model Name: SPH-DA77DAB	
Serial Number: CATM123456EU	
MCU: PIO_WM02_1.0.01	
SOC: PIO_WS02_1.0.07	
Interface FW Version: 1.0.7	

\_\_\_\_

If you have any difficulty performing these instructions, please contact the Pioneer Technical Support team on 1800 988 268, Monday through Friday, 9:00 AM - 4:30 PM (excluding holidays).

Copyright 2024 Pioneer Corporation