



Firmware Update Instructions for the Pioneer AVH-X5700DAB

This firmware update (version 08.25) applies only to the Pioneer AVH-X5700DAB. If you have purchased a unit from outside Australia, please visit your local Pioneer website.

IMPORTANT

Please download and print these Firmware Update instructions before downloading and installing the firmware update. It is important that you complete all steps correctly and in the order described below.

Note: If you have any questions or concerns, please contact the Pioneer Australia tech call centre, prior to undertaking this firmware update (1800 672 102).

In order to perform this update, the following items are needed:

- Pioneer AVH-X5700DAB
- A blank USB storage device (no files), 2 GB or larger in capacity, formatted to FAT32.

CAUTION

- DO NOT turn your unit off or disconnect the USB storage device while the firmware is being updated.
- You can only update the firmware when the vehicle is stopped and the parking brake is engaged.

Checking the firmware version

Check whether the firmware of your unit needs to be updated by checking the version number of the firmware.

PROCEDURE

1. Start the vehicle engine.
2. Press the [Home] button.
3. Touch the [AV source] & touch [Off] to source Off.




*This picture shows typical region source. It's not complete same your region.




4. Touch the [Setting] icon.



5. Select [System information] for select menu of system setting.

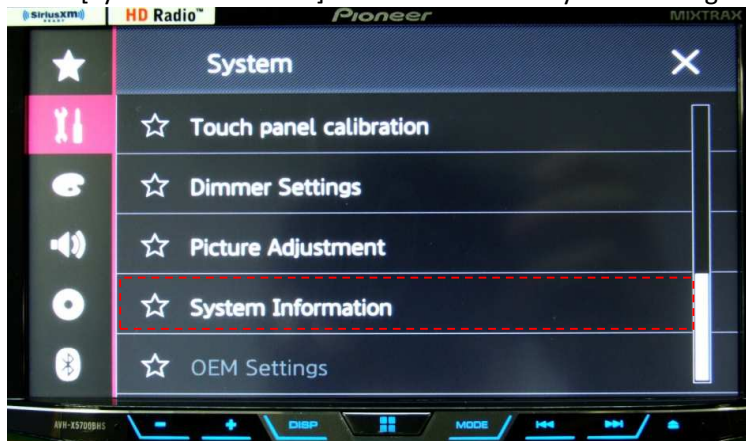

6. Select [Firmware information].

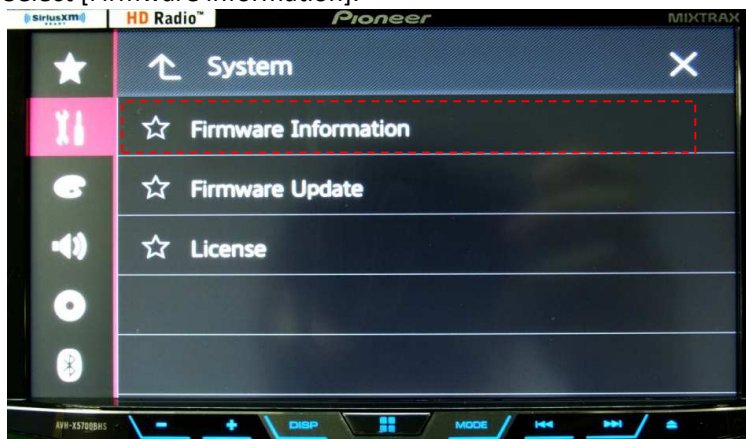



7. Confirm current version of the product.
(If the firmware version shows "08.25" or higher, no further action is necessary.)

A. Downloading the Firmware Update Files

1. Download the firmware update files by clicking on the following link and finding your product:
<http://www.pioneer.com.au/au/support/page.html>
2. Extract the download file. (Ver 08.25)

B. Updating the Firmware on Your Unit

IMPORTANT

- Ensure that the update file is located within the root (top) folder of your USB storage device. There should be no other files within the USB storage device.
- While your unit is being updated, DO NOT turn off the system's power and DO NOT touch the unit's touchscreen as this may result in severe damage to your unit.
- DO NOT remove the USB storage device during the firmware update process.
- Disconnect any external mobile devices that are currently connected to your unit.

PROCEDURE

1. Connect a blank (formatted) USB storage device to your computer, and then locate and copy the correct firmware file onto the USB storage device.
2. Start the vehicle engine.
3. Connect the USB storage device to the USB input on your unit.
4. Press the [Home] button.
5. Touch the [AV source] & touch [Off] to source Off.




*This picture shows typical region source. It's not complete same your region.



6. Touch [Setting] icon.



7. Select [System information] to select the system setting menu.

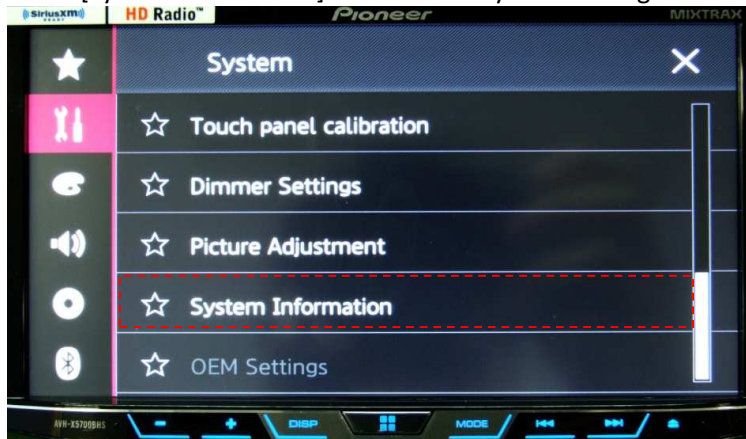

8. Select [Firmware Update].







9. Touch [Continue].



10. Read the "WARNING," then touch the [Start] button to start the update process. If it shows "ERROR" on the display, try another USB device.

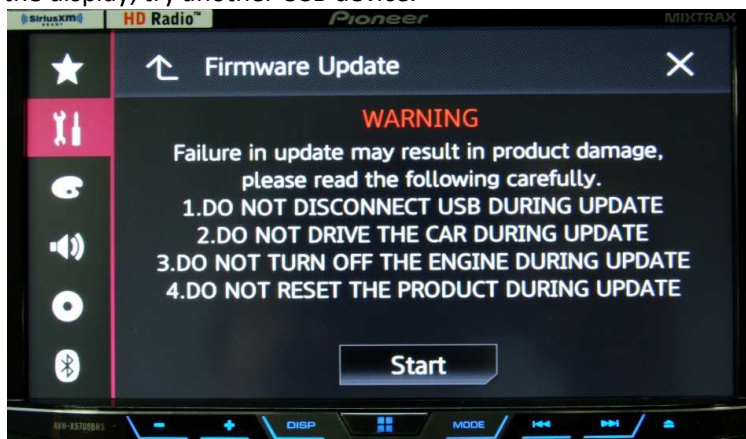

11. After starting, there will be a progress bar while updating.

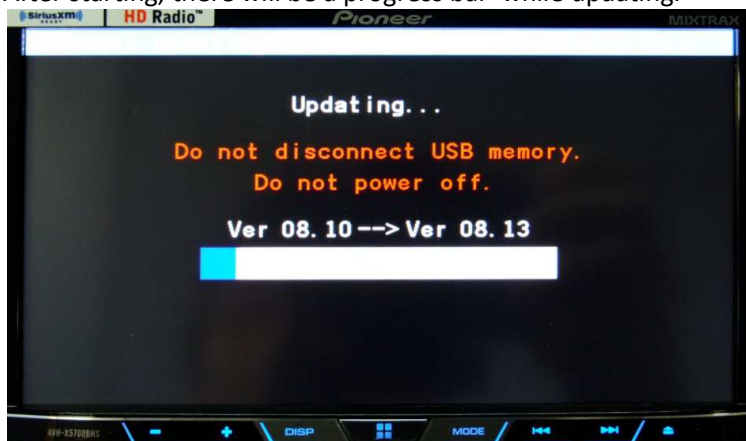



12. Display will show "It succeeded..." when the update is complete.



13. The product will reboot after the update is finished. Do not touch anything even when the screen is blacked out. After it has finished rebooting, the screen will return to the menu screen. **PLEASE NOTE: screen may appear blank for up to 40-60 seconds**



*This picture shows typical region source. It's not complete same your region.

14. The firmware update is now complete. Your Pioneer Multimedia Receiver is now ready for use.